


Instrukcja montażu adaptera potencjometru przyspieszenia BMW do pedału Nissan.


1. Zdemontować potencjometr i zabierak z pedału gazu Nissana. Nakrętka M6 i podkładka będą potrzebne później.

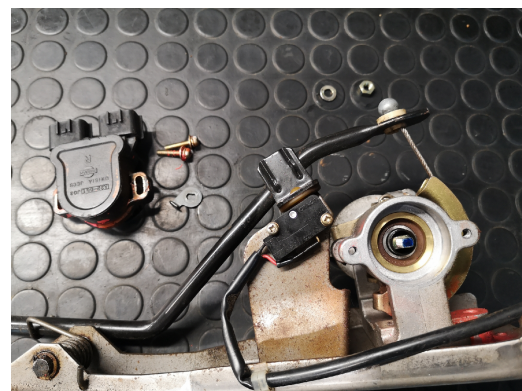

2. Zdemontować potencjometr od pedału gazu BMW za pomocą torxa T10 z otworem jak na zdjęciu poniżej.



3. Używając nakrętki M6 z podkładką zamontować zabierak i adapter jak na zdjęciu.


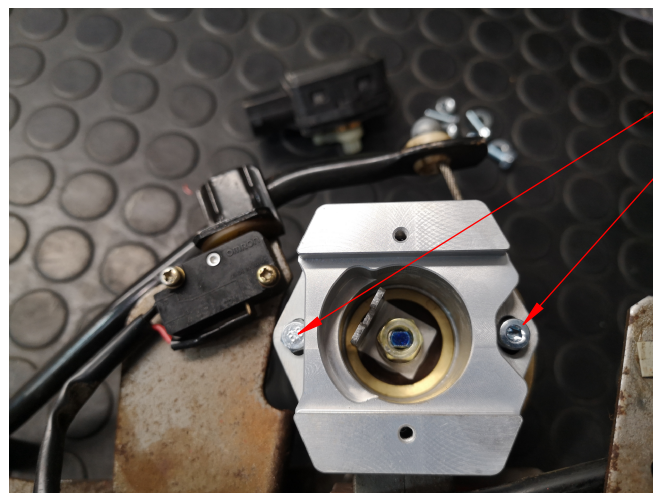


Użyć śrub z zestawu i ustawić adapter w połowie zakresu regulacji.


Śrubę DIN933 M4x10 należy początkowo zostawić luźno.

Śrubę DIN4762 M4x10 dokręcić.

4. Wykonać gwint M6 w korpusie pedału gazu Nissana, w miejscu oznaczonym na zdjęciu. Dodatkowa regulacja pozwala ustawić odpowiedni luz na pedale gazu.

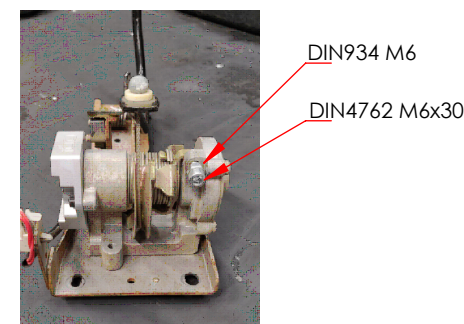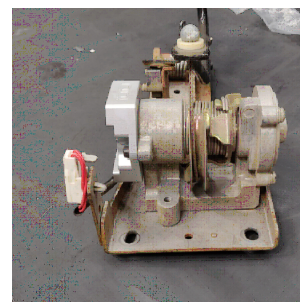

5. Usunąć gumowy ogranicznik pozycji zerowej i zamontować śruby M5 z nakrętkami jak na zdjęciu.

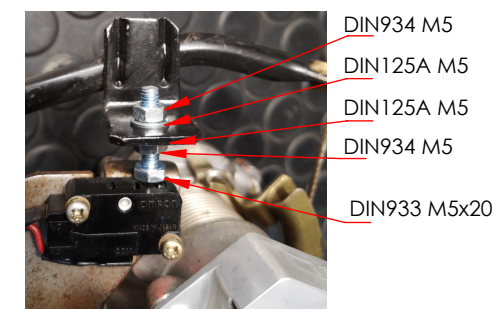

6. Za pomocą śrub DIN4762 M3x12 przykrecić potencjometr BMW jak na zdjęciu.



7. Po wyregulowaniu luzu na pedale gazu (punkt nr.4) należy ustawić odpowiednie położenie kątowe adaptera tak by potencjometr BMW działał w zakresie 0-100% i dokręcić śrubami z punktu nr.3.



Assembly instructions for the BMW potentiometer adapter for the Nissan pedal.


1. Remove the potentiometer and control plate from the Nissan accelerator pedal.
The M6 nut and washer will be needed later.



2. Remove the potentiometer from the BMW accelerator pedal using a T10 torx with a hole as in the photo below.



3. Using the M6 nut with a washer, mount the control plate and adapter as photo.


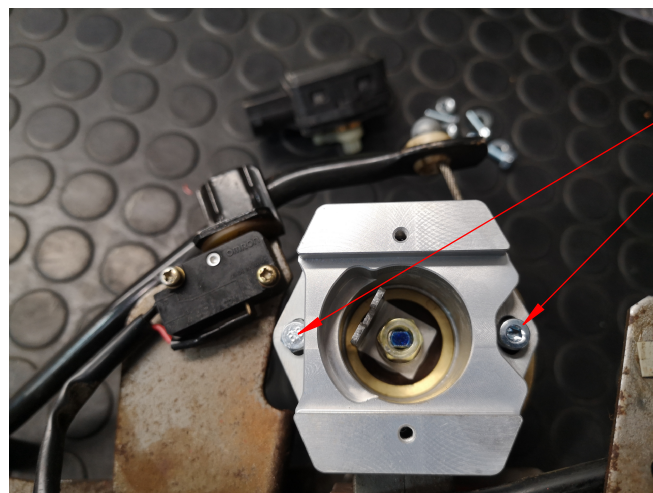


Use the screws from kit as shown in the photo when placing the adapter halfway through the adjustment.


The DIN933 M4x10 should initially be left loose.

The DIN4762 M4x10 should be tight.

4. Make an M6 thread in the Nissan gas pedal body, in the place marked in the photo.
Additional adjustment allows you to set the appropriate clearance on the gas pedal.

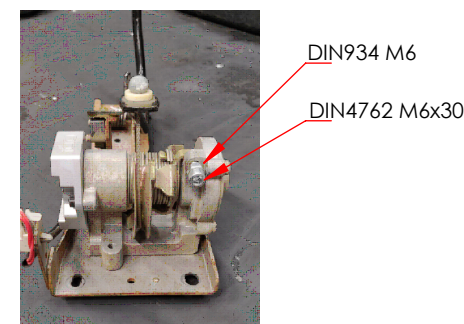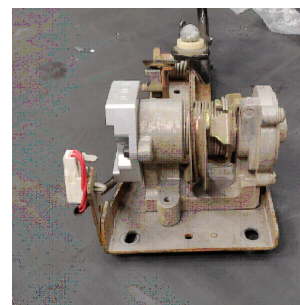

5. Remove the rubber stopper of position 0 and using the M5 screw with nuts as shown in the photo.

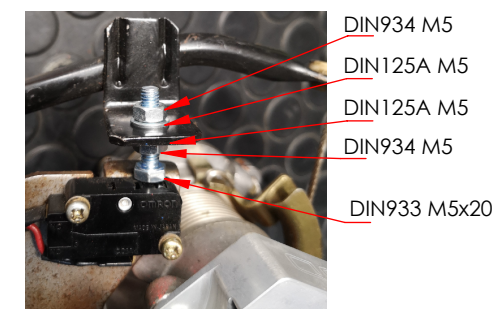

6. Use the DIN4762 M3x12 to adjust the BMW potentiometer to IOD adapter as shown in the photo.



7. After adjusting clearance on the gas pedal (point no. 4), set the appropriate angular position adapter so that the BMW potentiometer works in the range of 0-100% and tighten with screws from point no. 3.

